



## Fitting Procedure


Clamp the hinge to the plate shown

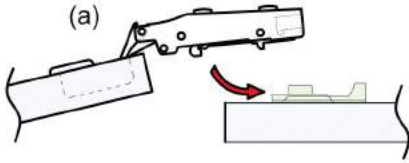

Press down the hinge arm to lock the plate as shown as direction arrow in

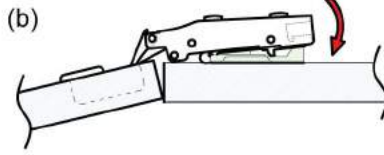


Disassembling shown as diagram (c) by pushing the clip button

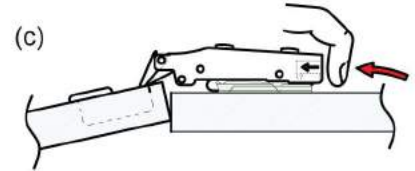

## Overlay Calculations for Plate Selection

### Inset

$$H=4.5+K+A$$

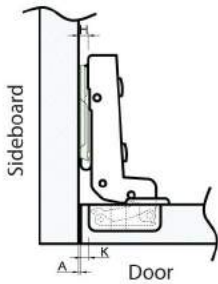


#### Reveal Calculations

$\frac{A}{H}$ \ $\frac{K}{H}$	3	4	5	6
0	1.5	0.5	-0.5	-1.5
2	3.5	2.5	1.5	0.5
4	5.5	4.5	3.5	2.5

### Half Overlay

$$H=5+K-D$$

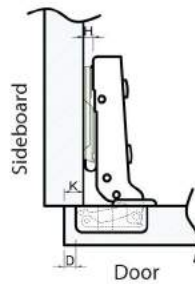


#### Overlay Calculations

$\frac{D}{H}$ \ $\frac{K}{H}$	3	4	5	6
0	17	18	19	20
2	15	16	17	18
4	13	14	15	16

### Full Overlay

$$H=14+K-D$$


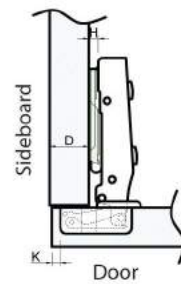


#### Overlay Calculations



$\frac{D}{H}$ \ $\frac{K}{H}$	3	4	5	6
0	8	9	10	11
2	6	7	8	9
4	4	5	6	7

## Adjustment Range

### Height Adjustment

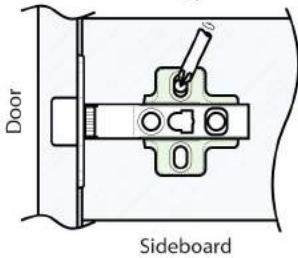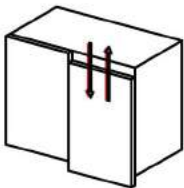

### Depth Adjustment

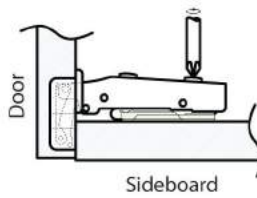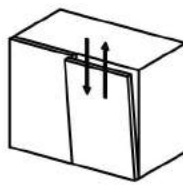

### Side Adjustment

